

GA-201

Tack-Free, Moisture- and Chemical-Resistant FIP Gasket

APPLICATIONS

- Sealing Plastic Surfaces & Enclosures
- Sealing Glass Surfaces & Enclosures
- Sealing Metal Surfaces & Enclosures
- Sealing Plated Surfaces

FEATURES

- UV/Visible Light Cure
- Tack Free After Proper Cure
- · Moisture and Chemical Resistant
- Soft and Durable After Proper Cure
- Conforms to Intricate Channels and Recesses

SURFACES

- Plastics
- Glass
- Aluminum
- Stainless Steel
- Plated Surfaces

Dymax [®] GA-201 form-in-place, cure-in-place gasketing resin is formulated for sealing plastic, glass and metal enclosures, and plated surfaces for automotive door handle, appliance housing, and critical electronic assembly and device applications which require a soft, tack-free, flexible gasket. This FIP gasket acts as a barrier to moisture to prevent absorption or penetration of air, dust, noise, liquids, gaseous substances, or dirt. It can be dispensed in intricate and complex configurations with the added benefit of curing in-line which allows for increased production speed and reduced inventories. Dymax resins contain no nonreactive solvents and cure upon exposure to light. Their ability to cure in seconds enables faster processing, greater output, and lower assembly costs. When cured with Dymax light-curing spot lamps, focused-beam lamps, or flood lamps, they deliver optimum speed and performance for maximum efficiency. Dymax lamps offer the ideal balance of UV and visible light for the fastest, deepest cures. This product is in full compliance with RoHS directives 2015/863/EU.

TYPICAL UNCURED PROPERTIES *			
Property	Value	Test Method	
Solvent Content	No Nonreactive Solvents	N/A	
Chemical Class	Acrylated Urethane	N/A	
Appearance	Opaque Gel	N/A	
Solubility	Organic Solvents	N/A	
Density, g/ml	1.01	ASTM D1875	
Viscosity, cP (20 rpm)	65,000 (nominal)	DSTM 502	
Soluble in	Organic Solvents	N/A	
Shelf Life at Recommended Conditions from Date of Manufacture	9 months	N/A	

CURED MECHANICAL PROPERTIES *			
Property	Value	Test Method	
Durometer Hardness	A35	ASTM D2240	
Tensile at Break, MPa [psi]	0.93 [135]	ASTM D638	
Elongation at Break, %	165	ASTM D638	
Modulus of Elasticity, MPa [psi]	0.75 [110]	ASTM D638	
Glass Transition Tg, °C	8	ASTM D5418	
Compression Set, % (85°C, 22 hr)**	26	ASTM D395	

OTHER CURED PROPERTIES *		
Property	Value	Test Method
Linear Shrinkage, %	1.1	ASTM D2566
Boiling Water Absorption, % (2 hr)	1.4	ASTM D570
Water Absorption, % (25°C, 24 h)	1.4	ASTM D570

Chemical Resistance - % of Initial Weight	Weight Immediately After Exposure	Weight 1 Week After Exposure
Chemical	Weight Immediately after Exposure	Weight 1 week after exposure
Motor Oil SAE 10W-30	101%	101%
Brake Fluid	147%	143%
Transmission Fluid	102%	102%
Diesel Fuel	124%	117%
Power Steering Fluid	101%	101%
Salt Water 5% NaCl	100%	99%
Isopropyl Alcohol 99%	184%	97%
Suntan Lotion SPF 50	106%	105%
Hand Lotion	103%	101%

Note:

The samples were immersed in fluid for 72 hours at room temperature. Immediately - wiped clean and weight measured.

1 week - Wiped clean, left at room temperature for 1 week and then weight measured.

N/A Not Applicable

© 2025 Dymax Corporation. All rights reserved.

All trademarks in this guide, except where noted, are the property of, or used under license by Dymax Corporation, U.S.A. Technical Data Collected PRIOR TO 2013 Rev.02/10/2023

^{*} Not Specifications

[‡] DSTM Refers to Dymax Standard Test Method

^{**} Compression set is expressed as percentage of deflection per ASTM D395 Method B at 25% deflection. To determine percent recovery, subtract ¼ of the value from 100%. For example, the recovery is 98.8% with a 5% compression set.



DISPENSE EQUIPMENT RECOMMENDATIONS *			
Application	Manual	Semi-Automated	Fully Automated
Beads	SD-100	Model 400 Needle Valve	Eco-PEN

CURING EQUIPMENT RECOMMENDATIONS *			
Process Method	Spot Lamp	Flood Lamp	Conveyor
Broad Spectrum	BlueWave® 400	5000 ECE or PortaRay 400	UVCS Conveyor with Fusion F300 Lamp

CURING GUIDELINES

Cure rate is dependent upon many variables, including lamp intensity, distance from the light source, and required depth of cure. The cure time listed below is based upon lab tests and is intended for reference only. Cure time is defined as the time to achieve a full cure of a 3.2 mm [0.13 in] thick gasket.

Dymax Curing System (Intensity)	Fixture Time or Belt Speed ^A
5000-EC (250 mW/cm ²) ^B	30 sec
BlueWave® 200 (10 W/cm²) ^B	3 sec
UVCS Conveyor with Two 5000-EC, In Series (250 $$ mW/cm²) $^{\hbox{\scriptsize C}}$	0.6 m/min [2 ft/min]
UVCS Conveyor with Fusion F300S (2.5 W/cm ²) ^C	7.6 m/min [25 ft/min]

A Intensity was measured over the UVA range (320-395 nm) using a Dymax ACCU-CAL™ 50 Radiometer. Curing through light-blocking substrates may require longer cure times if they obstruct wavelengths used for light curing (320-400 nm for UV light curing, 320-450 nm for UV/Visible light curing). These fixture times/belt speeds are typical for curing thin films through 100% light-transmitting substrates

C At 53 mm [2.1 in] focal distance. Maximum speed of conveyor is 8.2 m/min [27 ft/min]. Intensity was measured over the UVA range (320-395 nm) using the Dymax ACCU-CAL™ 160 Radiometer.

Full cure is best determined empirically by curing at different times and intensities, and measuring the corresponding change in cured properties. Full cure is defined as the point at which more light exposure no longer improves cured properties. Higher intensities or longer cures may degrade Dymax light-curable resins.


Dymax recommends that customers employ a safety factor by curing longer and/or at higher intensities than required for full cure. Although Dymax Application Engineering can provide technical support and assist with process development, each customer must ultimately determine and qualify the appropriate curing parameters required for their unique application.

B Intensity was measured over the UVA range (320-395 nm) using a Dymax ACCU-CAL m 50 Radiometer.



DEPTH OF CURE

The graph below shows the increase in depth of cure as a function of exposure time. A 9.5 mm [0.37 in] diameter specimen was cured in a polypropylene mold and cooled to room temperature. It was then released from the mold and the cure depth was measured.

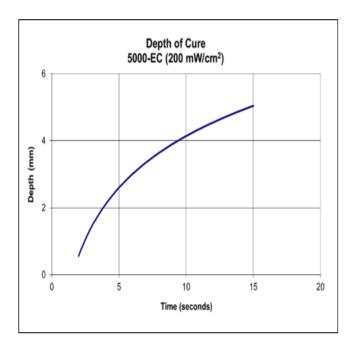

OPTIMIZING PERFORMANCE AND HANDLING

- 1. This product cures with exposure to UV and visible light. Exposure to ambient and artificial light should be kept to a minimum before curing. Dispensing components, including needles and fluid lines, should be 100% light blocking, not just UV blocking.
- 2. All surfaces in contact with the resin should be clean and free from grease, mold release, or other contaminants prior to dispensing the gasketing resin.
- 3. Oxygen in the atmosphere may inhibit surface cure. Surfaces exposed to air may require higher intensity UV (> 100 mW/cm²) to produce a tack-free cure. Flooding the bond area with an inert gas, such as nitrogen, can also reduce the effects of oxygen inhibition.
- 4. Part should be allowed to cool after cure before testing.
- 5. Light curing generally produces some heat. If necessary, cooling fans can be placed in the curing area to reduce the heating effect on components.
- 6. At the point of curing, an air exhaust system is recommended to dissipate any heat and vapors formed during the curing process.
- 7. Cure speed is dependent upon many variables, including lamp intensity, distance from the light source, required depth of cure, bond gap, and percent light transmission of the substrate.

DISPENSING SUPPORT

The Dymax Application Engineering team is ready to discuss your application requirements to provide the most appropriate dispensing and/or spraying solution. Visit our current dispensing equipment portfolio here or consult our global contact phone numbers and online chat feature (available in North America only) during normal business hours for instant support.



STORAGE AND SHELF LIFE

Store the material in a cool, dark place when not in use. Do not expose to visible or UV light. This product may polymerize upon prolonged exposure to ambient and artificial light. Keep covered when not in use. This material shelf life is noted on page 1 of this document, when stored between 10° C (50° F) and 32° C (90° F) in the original, unopened container. GA-201 in pails may exhibit a hazy, whitish appearance after exposure to cold temperatures. If such an appearance is noticed, the material should be placed in an ambient environment of 20° C -24° C (68° F -75° F) for at least 3 days. We do not recommend accelerating the warming with additional heat as it will adversely impact the uncured material. After the recommended warming-up step, the clear material is suitable for its intended use.

CLEANUP

Uncured material may be removed from dispensing components and parts with organic solvents. Cured material will be impervious to many solvents and difficult to remove. Cleanup of cured material may require mechanical methods of removal.

GENERAL INFORMATION

This product is intended for industrial use only. Keep out of the reach of children. Avoid breathing vapors. Avoid contact with skin, eyes, and clothing. Wear impervious gloves. Repeated or continuous skin contact with uncured material may cause irritation. Remove material from skin with soap and water. Never use organic solvents to remove material from skin and eyes. For more information on the safe handling of this material, please refer to the Safety Data Sheet before use.

The data provided in this document are based on historical testing that Dymax performed under laboratory conditions as they existed at that time and are for informational purposes only. The data are neither specifications nor guarantees of future performance in a particular application. Dymax does not guarantee that this product's properties are suitable for the user's intended purpose.

Numerous factors—including, without limitation, transport, storage, processing, the material with which the product is used, and the ultimate function or purpose for which the product was obtained—may affect the product's performance and/or may cause the product's actual behavior to deviate from its behavior in the laboratory. None of these factors are within Dymax's control. Conclusions about the behavior of the product under the user's particular conditions, and the product's suitability for a specific purpose, cannot be drawn from the information contained in this document.

It is the user's responsibility to determine (i) whether a product is suitable for the user's particular purpose or application and (ii) whether it is compatible with the user's intended manufacturing process, equipment, and methods. Under no circumstances will Dymax be liable for determining such suitability or compatibility. Before the user sells any item that incorporates Dymax's product, the user shall adequately and repetitively test the item in accordance with the user's procedures and protocols. Unless specifically agreed to in writing, Dymax will have no involvement in, and shall under no circumstances be liable for, such testing.

Dymax makes no warranties, whether express or implied, concerning the merchantability of this product or its fitness for a particular purpose. Nothing in this document should be interpreted as a warranty of any kind. Under no circumstances will Dymax be liable for any injury, loss, expense or incidental or consequential damage of any kind allegedly arising in connection with the user's handling, processing, or use of the product. It is the user's responsibility to adopt appropriate precautions and safeguards to protect persons and property from any risk arising from such handling, processing, or use.

The specific conditions of sale for this product are set forth in Dymax's <u>General Terms & Conditions of Sale</u>. Nothing contained herein shall act as a representation that the product use or application is free from patents owned by Dymax or any others. Nothing contained herein shall act as a grant of license under any Dymax Corporation Patent.

Except as otherwise noted, all trademarks used herein are trademarks of Dymax. The "®" symbol denotes a trademark that is registered in the U.S. Patent and Trademark Office.

The contents of this document are subject to change. Unless specifically agreed to in writing, Dymax shall have no obligation to notify the user about any change to its content.



CONTACT DYMAX

www.dymax.com

Americas

USA | +1.860.482.1010 | info@dymax.com Mexico | +1.915.315.9381 | info-LATAM@dymax.com

Europe

Germany | +49 611.962.7900 | info_de@dymax.com | Ireland | +353 21.237.3016 | info_ie@dymax.com

Asia

Singapore | +65.67522887 | info_ap@dymax.com
Shenzhen | +86.755.83485759 | info@hanarey.com
Hong Kong | +852.2460.7038 | dymaxasia@dymax.com
Korea | +82.31.608.3434 | info_kr@dymax.com