

SpecSeal® Connection Protection
(Part Number: CP100)**Bolted Installation:****Hardware Required:**

- Min 1/4" (6.4 mm), 2" (51 mm) min length anchor & 1 1/4" (32 mm) wide, 3/16" (4.8 mm) thick fender washers or equivalent

Installation:

1. Drill clearance holes with 3/16" (4.8 mm) bit at locations marked.
2. Supporting the cover against the ceiling and curtain wall insulation, drive in screw anchors.

Powder Actuated Nail Gun Installation (Alternate):**Hardware Required:**


- Power level 2 or 3 (brass case, brown or green, respectively) low velocity charge, 0.22 caliber
- Min 2" (51 mm) long with min 7/8" (22 mm) diameter 16 gauge washers

Installation:


1. Supporting the cover against the ceiling and curtain insulation, shoot nails in marked locations.

Anchor Notch Modification:


- To adjust notch for thicknesses of greater than 1/2" (12.7 mm), using a utility knife, carefully score to desired depth and width and remove material.

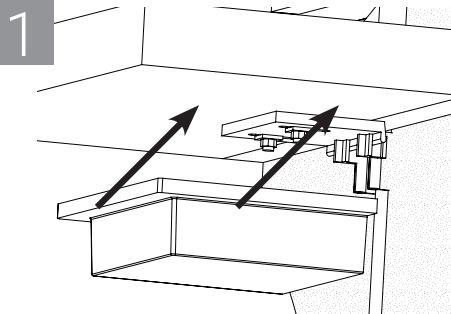

Install around connector, snug to insulation.

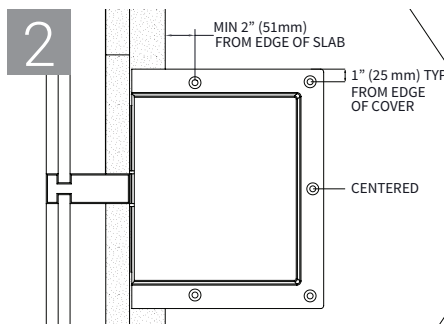

Using anchor, drill or shoot min. 5 fasteners through flange.

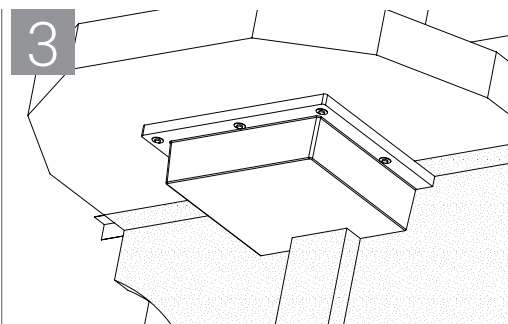

Install Mullion Covers per UL® system.

Ingredient(s)
Refractory Ceramic Fiber (RCF)
CAS# 142844-00-6

**Warning**

Suspected of causing cancer by inhalation.

- Do not handle until all safety instructions have been read and understood.
- Use respiratory protection as required; see section 8 of the Safety Data Sheet.
- If concerned about exposure, get medical advice.
- Store in a manner to minimize airborne dust.
- Dispose of waste in accordance with local, state and federal regulations.
- May cause temporary mechanical irritation to exposed eyes, skin or respiratory tract.
- Minimize exposure to airborne dust.

Attention

Susceptible de provoquer le cancer par inhalation.

- Ne pas manipuler jusqu'à ce que toutes les consignes de sécurité ont été lu et compris.
- Utiliser une protection respiratoire tel que requis; voir la section 8 de la fiche de données de sécurité.
- Si préoccupé par l'exposition, obtenir des conseils médicaux.
- Entreposer de façon à réduire au minimum la poussière en suspension.
- Éliminer les déchets conformément aux prescriptions locales, états et les règlements fédéraux.
- Peut provoquer une irritation mécanique temporaire yeux exposés, la peau ou des voies respiratoires.
- Minimiser l'exposition à la poussière en suspension.

Advertencia

Se sospecha que provoca cáncer por inhalación.

- No maneje hasta que todas las instrucciones de seguridad tienen ha leído y entendido.
- Use protección respiratoria según sea necesario; mira la sección 8 de la ficha de datos de seguridad.
- Si preocupado por la exposición, obtener consejo médico.
- Tienda de manera de minimizar el polvo en suspensión.
- Eliminar los desperdicios de conformidad con las ordenanzas locales, estatales y regulaciones federales.
- Puede causar irritación mecánica temporal a ojos expuestos, la piel o el tracto respiratorio.
- Reducir al mínimo la exposición al polvo en el aire.

For a chemical emergency call 1-800-424-9300
STI assistance call 1-800-992-1180
for additional information or SDS visit www.stifirestop.com

Pour un appel d'urgence chimique 1-800-424-9300
STI produit d'appel 1-800-992-1180
Pour plus d'informations ou SDS visitez www.stifirestop.com

Para una llamada de emergencia química 1-800-424-9300
STI de asistencia sobre el producto 1-800-992-1180
Para más información o visita SDS www.stifirestop.com

Note: For more information on firestop installation, refer to ASTM E3157.

